

Asbestos Inspection Report

204 E. Marlboro Street
Florence, South Carolina

Prepared for: City of Florence

324 W. Evans Street

Florence, SC 29501

Annie Brown ahbrown@cityofflorence.com

Prepared by: Enga Hair, AHERA Building Inspector License #BI-01591



Date of Inspection: June 9, 2025

Date of Report: June 12, 2025

Project Number: 25-734-C

ECH CONSULTANTS

1823 Trade Street
Florence, SC
803.807.6488

June 12, 2025

Dr. Annie Brown, Ph.D
City of Florence
324 W. Evans Street
Florence, SC 29501


RE: 204 Marlboro Street
Florence, SC

Dear Dr. Brown,

We are pleased submit the enclosed limited Asbestos Inspection Report for the above captioned project. The inspection was conducted on June 9, 2025, in conformance with the South Carolina Department Environmental Services (SCDES) Standards of Performance for Asbestos Projects, Regulation 61-86.1 and the Environmental Protection Agency (EPA) minimum sampling requirements.

If you have any questions or need any additional information please do not hesitate to call me at 803.807.6488 or email me at enga@echconsultants.com.

Respectfully,



Enga Hair, CIH, PE, Owner

TABLE OF CONTENTS

EXECUTIVE SUMMARY	3
BACKGROUND	4
ASBESTOS FINDINGS	5
ASBESTOS CONCLUSIONS	7
PHOTOGRAPHS	8
ASBESTOS BULK SAMPLE ANALYSIS	
SCDES INSPECTOR LICENSE	

EXECUTIVE SUMMARY

The purpose of this investigation was to conduct a visual inspection, sample and analyze suspect asbestos containing materials (ACM) which may be disturbed during the future **demolition**, to determine if any occupational exposures and/or environmental releases of airborne asbestos may occur.

The suspect materials were those identified in the United States Environmental Protection Agency (EPA) manual, Guidance for Controlling Asbestos. The identification of ACM meet compliance standards established the EPA under regulation 40 CFR, Part 61, National Emission Standards for Hazardous Air Pollutants, Asbestos NESHAP Revision, Final Rule. Additional suspect ACMs may be present in locations that are inaccessible. If discovered, these suspect materials should be sampled and tested. A material that is of similar color, texture, age and size throughout the building to a material that has been identified as asbestos containing should be assumed to contain asbestos.

The survey was conducted by licensed inspector Enga Hair - #01591 on June 9, 2025. Bulk samples were recorded on a Chain of Custody and submitted to a Polarized Light Microscopy (PLM) laboratory. Eurofins|CEI Labs, Inc., located in Cary, North Carolina, is accredited by the National Voluntary Laboratory Accreditation Program (NVLAP) for satisfactory compliance with criteria established in Title 15, part 7, Code of Regulations, by the National Institute of Standards and Technology (NIST). The laboratory analysis reports the specific type of asbestos identified (there are six (6) types of asbestos minerals) and the percentage of asbestos present.

The EPA defines materials as asbestos containing IF an asbestos content of greater than 1% is detected in a representative sample. The sampling strategy utilized throughout the survey complies with the instructions specified in the EPA Regulation 40 CFR, Part 763.

ECH Consultants appreciates the opportunity to provide this limited asbestos inspection report for use by City of Florence and their assigns.

BACKGROUND

The structure located at 204 E. Marlboro Street, Florence, South Carolina, is scheduled for a future demolition. The facility has the following characteristics:

- Single story wooden structure
- Approximately 950 Square Feet
- Approximately 950 Square Feet of Shingles
- Approximately 2,300 Square Feet of plaster on ceilings and walls
- Approximately 950 Square Feet of ceiling texture
- Wooden floors throughout
- Ceramic Tile in kitchen
- Wooden windows with Approximately 110 LF of window glaze; no caulk

ASBESTOS FINDINGS

The following Table details the thirteen (13) Bulk Samples taken; twenty-one (21) layers analyzed

Sample #	Description	Classification	Condition	Potential for Disturbance
1	Plaster Skim	None Detected	Damaged	Low
	Plaster Base	None Detected	Damaged	Low
2	Plaster Skim	None Detected	Damaged	Low
	Plaster Base	None Detected	Damaged	Low
3	Plaster Skim	None Detected	Damaged	Low
	Plaster Base	None Detected	Damaged	Low
4	Plaster Skim	None Detected	Damaged	Low
	Plaster Base	None Detected	Damaged	Low
5	Plaster Skim	None Detected	Damaged	Low
	Plaster Base	None Detected	Damaged	Low
6	Ceiling Texture	None Detected	Damaged	Low
7	Ceiling Texture	None Detected	Damaged	Low
8	Ceiling Texture	None Detected	Damaged	Low
9	Window Glaze	<1%	Good	Low
10	Window Glaze	<1%	Good	Low
11	Window Glaze	None Detected	Good	Low
12	Shingle	None Detected	Good	Low
	Tar	None Detected	Good	Low
13	Shingle	None Detected	Good	Low

Sample #	Description	Classification	Condition	Potential for Disturbance
	Tar	None Detected	Good	Low
14	Shingle	None Detected	Good	Low

Please refer to the enclosed Asbestos Analysis for additional information

ASBESTOS CONCLUSIONS

The following represents areas that are POSITIVE for Asbestos:

Non-Friable: N/A


Friable: N/A

*No Asbestos Containing Materials identified in this inspection


PHOTOGRAPHS



PHOTOGRAPH 1

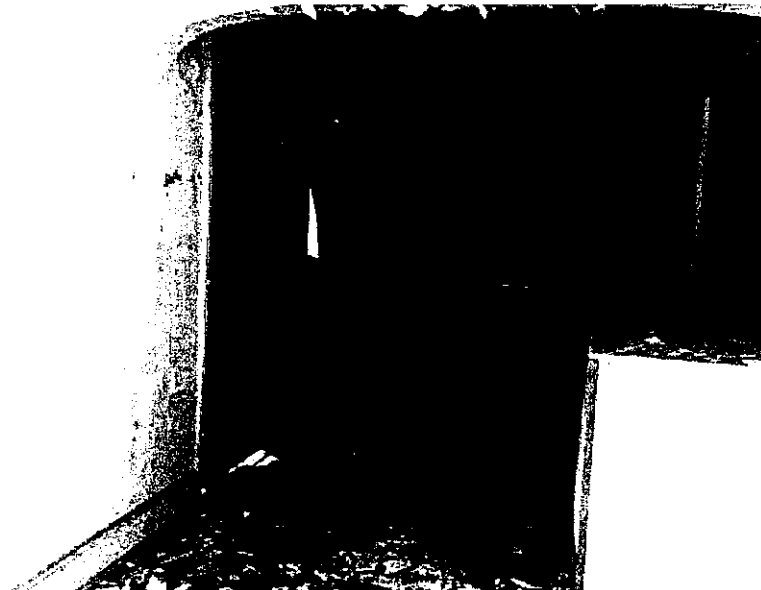

PHOTOGRAPH 2

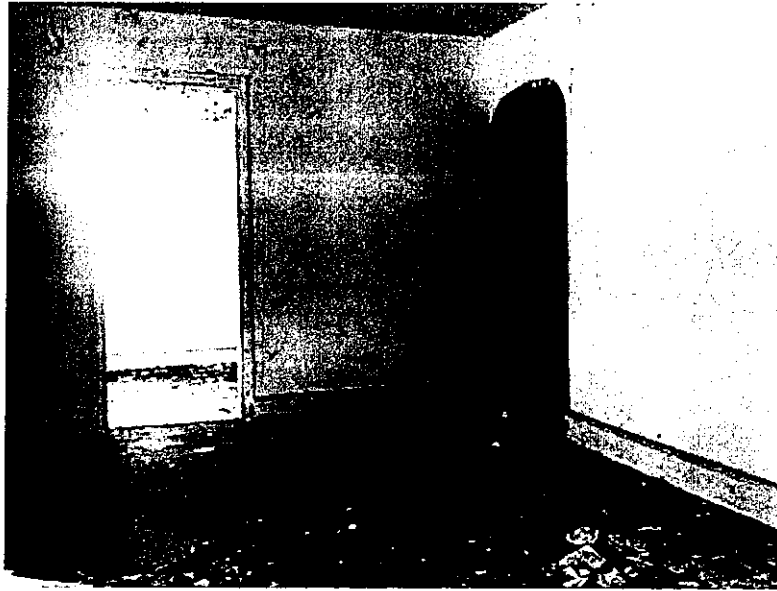

PHOTOGRAPH 3



PHOTOGRAPH 4

ASBESTOS BULK SAMPLE ANALYSIS



Built Environment Testing

June 11, 2025

Enga Hair
ECH Consultants
1823 Trade Street
Florence, SC 29501

CLIENT PROJECT: 204 Marlboro Street, Florence
LAB CODE: 664577-1

Dear Enga,

Enclosed are asbestos analysis results for PLM Bulk samples received at our laboratory on June 10, 2025. The samples were analyzed for asbestos using polarizing light microscopy (PLM) per the EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials and EPA 40 CFR Appendix E to Subpart E of Part 763: Interim Method of the Determination of Asbestos in Bulk Insulation Samples.

Sample results containing >1% asbestos are considered asbestos-containing materials (ACMs) per EPA regulatory requirements. The detection limit for the EPA 600 Method is <1% by calibrated visual estimate.

Thank you for your business and we look forward to continuing good relations.

Kind Regards,

A handwritten signature in black ink, appearing to read "Tianbao Bai".

Tianbao Bai, Ph.D., CIH
Laboratory Director

NVLAP 101768-0



Built Environment Testing

ASBESTOS BULK ANALYSIS

By: Polarized Light Microscopy

Client: ECH Consultants
1823 Trade Street
Florence, SC 29501

Lab Code: 664577-1
Date Received: 06/10/25
Date Analyzed: 06/11/25
Date Reported: 06/11/25

Project: 204 Marlboro Street, Florence

Method: ASBESTOS BULK PLM, EPA 600 METHOD

Client ID	Lab	Lab	NON-ASBESTOS COMPONENTS		ASBESTOS
Lab ID	Description	Attributes	Fibrous	Non-Fibrous	%
4	Plaster Skim Coat	Heterogeneous	20%	Calc Carb	None Detected
Layer A		White	5%	Paint	
3450768		Non-Fibrous	75%	Binder	
		Bound			
Layer B	Plaster Base Coat	Homogeneous	<1%	Cellulose	65%
3450768		Gray		Silica	35%
		Non-Fibrous		Binder	None Detected
		Bound			
5	Plaster Skim Coat	Heterogeneous	20%	Calc Carb	None Detected
Layer A		White	5%	Paint	
3450769		Non-Fibrous	75%	Binder	
		Bound			
Layer B	Plaster Base Coat	Homogeneous	<1%	Cellulose	65%
3450769		Gray		Silica	35%
		Non-Fibrous		Binder	None Detected
		Bound			
6	Texture	Heterogeneous	85%	Binder	None Detected
3450770		White	5%	Paint	
		Non-Fibrous	10%	Vermiculite	
		Bound			
7	Texture	Heterogeneous	85%	Binder	None Detected
3450771		White	5%	Paint	
		Non-Fibrous	10%	Vermiculite	
		Bound			
8	Texture	Heterogeneous	85%	Binder	None Detected
3450772		White	5%	Paint	
		Non-Fibrous	10%	Vermiculite	
		Bound			



Built Environment Testing

ASBESTOS ANALYTICAL REPORT
By: Polarized Light Microscopy

Prepared for

ECH Consultants

CLIENT PROJECT: 204 Marlboro Street, Florence

LAB CODE: 664577-1

TEST METHOD: EPA 600 / R93 / 116 and EPA 40 CFR Appendix E to Subpart
E of Part 763

REPORT DATE: 06/11/25



Built Environment Testing

Asbestos Report Summary
By: Polarized Light Microscopy

Project: 204 Marlboro Street, Florence

Lab Code: 664577-1

Method: EPA 600 / R93 / 116 and EPA 40 CFR Appendix E to Subpart E of Part 763

Client ID	Lab ID	Layer	Sample Description	Asbestos %
1	3450765	Layer A	White plaster skim coat	None Detected
		Layer B	Gray plaster base coat	None Detected
2	3450766	Layer A	White plaster skim coat	None Detected
		Layer B	Gray plaster base coat	None Detected
3	3450767	Layer A	White plaster skim coat	None Detected
		Layer B	Gray plaster base coat	None Detected
4	3450768	Layer A	White plaster skim coat	None Detected
		Layer B	Gray plaster base coat	None Detected
5	3450769	Layer A	White plaster skim coat	None Detected
		Layer B	Gray plaster base coat	None Detected
6	3450770		White texture	None Detected
7	3450771		White texture	None Detected
8	3450772		White texture	None Detected
9	3450773		White/gray glazing	Chrysotile <1%
10	3450774		White/gray glazing	Chrysotile <1%
12	3450775	Layer A	Gray/black shingle	None Detected
		Layer B	Black tar	None Detected
13	3450776	Layer A	Gray/black shingle	None Detected
		Layer B	Black tar	None Detected



Built Environment Testing

ASBESTOS BULK ANALYSIS

By: Polarized Light Microscopy

Client: ECH Consultants
1823 Trade Street
Florence, SC 29501

Lab Code: 664577-1
Date Received: 06/10/25
Date Analyzed: 06/11/25
Date Reported: 06/11/25

Project: 204 Marlboro Street, Florence

Method: ASBESTOS BULK PLM, EPA 600 METHOD

Client ID	Lab	Lab	NON-ASBESTOS COMPONENTS				ASBESTOS
Lab ID	Description	Attributes	Fibrous		Non-Fibrous		%
1	Plaster Skim Coat	Heterogeneous			20%	Calc Carb	None Detected
Layer A		White			5%	Paint	
3450765		Non-Fibrous			75%	Binder	
		Bound					
Layer B	Plaster Base Coat	Homogeneous	<1%	Cellulose	65%	Silica	None Detected
3450765		Gray			35%	Binder	
		Non-Fibrous					
		Bound					
2	Plaster Skim Coat	Heterogeneous			20%	Calc Carb	None Detected
Layer A		White			5%	Paint	
3450766		Non-Fibrous			75%	Binder	
		Bound					
Layer B	Plaster Base Coat	Homogeneous	<1%	Cellulose	65%	Silica	None Detected
3450766		Gray			35%	Binder	
		Non-Fibrous					
		Bound					
3	Plaster Skim Coat	Heterogeneous			20%	Calc Carb	None Detected
Layer A		White			5%	Paint	
3450767		Non-Fibrous			75%	Binder	
		Bound					
Layer B	Plaster Base Coat	Homogeneous	<1%	Cellulose	65%	Silica	None Detected
3450767		Gray			35%	Binder	
		Non-Fibrous					
		Bound					



Built Environment Testing

ASBESTOS BULK ANALYSIS

By: Polarized Light Microscopy

Client: ECH Consultants
1823 Trade Street
Florence, SC 29501

Lab Code: 664577-1
Date Received: 06/10/25
Date Analyzed: 06/11/25
Date Reported: 06/11/25

Project: 204 Marlboro Street, Florence

Method: ASBESTOS BULK PLM, EPA 600 METHOD

Client ID	Lab	Lab	NON-ASBESTOS COMPONENTS				ASBESTOS
Lab ID	Description	Attributes	Fibrous		Non-Fibrous		%
9 3450773	Glazing	Heterogeneous White/gray Non-Fibrous Bound	2%	Talc	5% 93%	Paint Binder	Chrysotile <1%
10 3450774	Glazing	Heterogeneous White/gray Non-Fibrous Bound	2%	Talc	5% 93%	Paint Binder	Chrysotile <1%
12 Layer A 3450775	Shingle	Heterogeneous Gray/black Fibrous Bound	50%	Glass	40% 10%	Tar Gravel	None Detected
Layer B 3450775	Tar	Heterogeneous Black Non-Fibrous Bound			100%	Tar	None Detected
13 Layer A 3450776	Shingle	Heterogeneous Gray/black Fibrous Bound	50%	Glass	40% 10%	Tar Gravel	None Detected
Layer B 3450776	Tar	Heterogeneous Black Non-Fibrous Bound			100%	Tar	None Detected



Built Environment Testing

LEGEND:

Non-Anth = Non-Asbestiform Anthophyllite

Non-Trem = Non-Asbestiform Tremolite

Calc Carb = Calcium Carbonate

METHOD: EPA 600 / R93 / 116 and EPA 40 CFR Appendix E to Subpart E of Part 763

REPORTING LIMIT: 1% by calibrated visual estimation

REGULATORY LIMIT: 1%

Due to the limitations of the EPA 600 / R93 / 116 method, nonfriable organically bound materials (NOBs) such as vinyl floor tiles can be difficult to analyze via polarized light microscopy (PLM). EPA recommends that all NOBs analyzed by PLM, and found not to contain asbestos, be further analyzed by Transmission Electron Microscopy (TEM). Please note that PLM analysis of dust and soil samples for asbestos is not covered under NVLAP accreditation. Estimated measurement of uncertainty is available on request.

Eurofins Built Environment Testing East, LLC makes no warranty representation regarding the accuracy of client submitted information in preparing and presenting analytical results. Interpretation of the analytical results is the sole responsibility of the client. This report relates only to the samples tested or analyzed and may not be reproduced, except in full, without written approval by Eurofins Built Environment Testing East, LLC. Samples were received in acceptable condition unless otherwise noted. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. Government.

Information provided by customer includes customer sample ID and sample description.

Nicholas Moore
Analyst

DATA QA:

Kathryn Wescott
6/11/2025

APPROVED BY:

Tianbao Bai, Ph.D., CIH
Laboratory Director



Built Environment Testing


RES Job #: 664577

SUBMITTED BY		INVOICE TO		CONTACT INFORMATION		SERIES	
Company:	ECH Consultants	Company:	ECH Consultants	Contact:	Enga Hair	-1 PLM	Priority
Address:	1823 Trade Street	Address:	1823 Trade Street	Phone:	(803) 807-6488	-2 TEM	Priority
				Fax:			
				Cell:	(803) 807-6488		
Project Number and/or P.O. #:	None Given	Project Zip Code:	Florence, SC 29501	Final Data Deliverable Email Address:	enga@echconsultants.com (+ 1 ADDNL CONTACTS)		
Project Description/Location:	204 Marlboro Street, Florence						

ASBESTOS LABORATORY		DTL		RUSH		PRIORITY		STANDARD		REQUESTED ANALYSIS					VALID MATRIX CODES					LAB NOTES								
PLM / PCM / TEM										PLM - PLM Short Report (EPA/600/R-92/116)	TEM - Semi-Quantitative (EPA/600/R-93-116 - "Chaffield")	PCB	DUST	CHEMISTRY	ORGANICS	VIABLES	MEDICAL	MOLD	ICO	Sample Volume (L) / Area	Sample Temperature (°C)	Length (or Aliquot) x Width (or Area/Aliquot)	Matrix Code	# of Containers	Date Collected mm/dd/yy	Time Collected hh:mm		
CHEMISTRY LABORATORY																												
Dust																									Air = A	Bulk = B		
																									Dust = D	Food = F		
Metals																									Paint = P	Soil = S		
																									Surface = SU	Swab = SW		
																									Tape = T	Wipe = W		
Organics*																									Drinking Water = DW			
MICROBIOLOGY LABORATORY																									Waste Water = WW			
Viable Analysis**																									**ASTM E1792 approved wipe media only**			
Medical Device Analysis																												
Mold Analysis																												
***Turnaround times establish a laboratory priority, subject to laboratory volume and are not guaranteed. Additional fees apply for afterhours, weekends and holidays.**																												
Special Instructions:																												
SC, stop positives, combine samples to make weight for TEM if needed																												
Client Sample ID Number																												
(Sample ID's must be unique)																												
1	1									X																		
2	2									X																		
3	3									X																		
4	4									X																		
5	5									X																		
6	6									X																		
7	7									X																		
8	8									X																		
9	9									X																		
10	10									X																		
11	11									X																		
12	12									X																		
13	13									X																		

Eurofins Built Environment Testing East, LLC establishes a unique Lab Sample ID, for each sample, by preceding each unique Client Sample ID with the laboratory RES Job Number. Eurofins Built Environment Testing East, LLC will analyze incoming samples based on information received and will not be responsible for errors or omissions in calculations resulting from the inaccuracy of original data. By signing, client/company representative agrees that submission of the following samples for requested analysis as indicated on this Chain of Custody email constitute an analytical services agreement with payment terms of NET 30 days. Failure to comply with payment terms may result in a 1.5% monthly interest surcharge.

Relinquished By:	CM	Date/Time: 06/10/2025 11:50:29	Sample Condition: Acceptable
Received By:	Carlos Romero	Date/Time: 06/10/2025 14:13:24	Carrier: Fed-Ex



Built Environment Testing

RES Job #: 664577

Submitted By: ECH Consultants

Client Sample ID Number 14 14	(Sample ID's must be unique)		REQUESTED ANALYSIS										VALID MATRIX CODES					LAB NOTES					
	ASBESTOS	PCM	DUST	METALS	ORGANICS	VIABLES	MEDICAL	MOLD	ICO	PLM - PLM Short Report (EPA/600/R-93/116)	TEM - Semi-Quantitative (EPA-600-R-93-116 - "Chafield")	PCB	DUST	METALS	ORGANICS	VIABLES	MEDICAL	MOLD	ICO	Matrix Code	# of Containers	Date Collected mm/dd/yy	Time Collected hh:mm
Air = A Bulk = B Dust = D Food = F Paint = P Soil = S Surface = SU Swab = SW Tape = T Wipe = W Drinking Water = DW Waste Water = WW **ASTM E1792 approved wipe media only**																							



ECG Lab Code: 664577

ECG Lab I.D. Range:

[illegible][illegible]

Wanted should be inter-Dept. for same reasons as in 1941 (attached)

Page 61



SAMPLING FORM

COMPANY CONTACT INFORMATION	
Company	Job Contact
Project Name	
Project ID #	

[illegible]



Built Environment Testing

June 11, 2025

Enga Hair
ECH Consultants
1823 Trade Street
Florence, SC 29501

CLIENT PROJECT: 204 Marlboro Street, Florence
LAB CODE: 664577-2

Dear Enga,

Enclosed are asbestos analysis results for TEM bulk samples received at our laboratory on June 10, 2025. The samples were analyzed for asbestos using transmission electron microscopy (TEM) per Chatfield/EPA 600/R-93/116 Sec. 2.5.5.1 method.

Sample results containing > 1% asbestos are considered asbestos-containing materials (ACMs) per the EPA regulatory requirements. The detection limit for the TEM Chatfield/EPA 600/R-93/116 Sec. 2.5.5.1 method is <1% depending on the processed weight and constituents of the sample.

Thank you for your business and we look forward to continuing good relations.

Kind Regards,

A handwritten signature in black ink, appearing to read "Tianbao Bai".

Tianbao Bai, Ph.D., CIH
Laboratory Director

NVLAP 101768-0



Built Environment Testing

ASBESTOS ANALYTICAL REPORT
By: Transmission Electron Microscopy

Prepared for

ECH Consultants

CLIENT PROJECT: 204 Marlboro Street, Florence

LAB CODE: 664577-2

TEST METHOD: Bulk Chatfield EPA 600 / R93 / 116 Sec. 2.5.5.1

REPORT DATE: 06/11/25



Built Environment Testing

ASBESTOS BULK ANALYSIS
By: Transmission Electron Microscopy

Client:	ECH Consultants 1823 Trade Street Florence, SC 29501	Lab Code:	664577-2
		Date Received:	06/10/25
		Date Analyzed:	06/11/25
		Date Reported:	06/11/25

Project: 204 Marlboro Street, Florence

Method: TEM BULK CHATFIELD / EPA 600 / R93 / 116 Sec. 2.5.5.1

Client ID	Material	Sample	Organic	Acid Soluble	Acid Insoluble	ASBESTOS
Lab ID	Description	Weight (g)	Material (%)	Material (%)	Material (%)	%
11	Off-white/gray glazing	0.4	17.13	64.23	18.64	None Detected
3450777						
14	Gray shingle	0.49	21.24	43.92	34.85	None Detected
3450778						



Built Environment Testing

LEGEND: None


METHOD: Bulk Chatfield EPA 600 / R93 / 116 Sec. 2.5.5.1

LIMIT OF DETECTION: Varies with the weight and constituents of the sample (<1%)

REGULATORY LIMIT: 1%

Eurofins Built Environment Testing East, LLC makes no warranty representation regarding the accuracy of client submitted information in preparing and presenting analytical results. Interpretation of the analytical results is the sole responsibility of the client. This report relates only to the samples tested or analyzed and may not be reproduced, except in full, without written approval by Eurofins Built Environment Testing East, LLC. Estimated measurement of uncertainty is available on request. Samples were received in acceptable condition unless otherwise noted.


Information provided by customer includes customer sample ID, location, volume and area as well as date and time of sampling. Eurofins Built Environment Testing East, LLC recommends between 0.500 and 0.200 grams of sample material. Any weight below 0.100 grams is considered below protocol guidelines.



Catherine Sheldon
Analyst

DATA QA:


Kamila Reichert
6/11/2025

APPROVED BY:

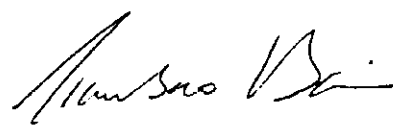
Tianbao Bai, Ph.D., CIH
Laboratory Director



Built Environment Testing


RES Job #: 664577

SUBMITTED BY		INVOICE TO		CONTACT INFORMATION		SERIES	
Company: ECH Consultants		Company: ECH Consultants		Contact: Enga Hair		-1 PLM Priority	
Address: 1823 Trade Street		Address: 1823 Trade Street		Phone: (803) 807-6488		-2 TEM Priority	
Florence, SC 29501		Florence, SC 29501		Fax: (803) 807-6488			
Project Number and/or P.O. #: None Given		Project Zip Code:		Cell: (803) 807-6488			
Project Description/Location: 204 Marlboro Street, Florence				Final Data Deliverable Email Address: eng@echconsultants.com (+ 1 ADDNL CONTACTS)			

ASBESTOS LABORATORY		DTL		RUSH	PRIORITY	STANDARD	REQUESTED ANALYSIS		VALID MATRIX CODES		LAB NOTES	
PLM/PCM/TEM												
CHEMISTRY LABORATORY												
Dust		RUSH		PRIORITY	STANDARD					Air = A	Bulk = B	
Metals		RUSH		PRIORITY	STANDARD					Dust = D	Food = F	
Organics*		SAME DAY		RUSH	PRIORITY	STANDARD				Paint = P	Soil = S	
MICROBIOLOGY LABORATORY										Surface = SU	Swab = SW	
Viable Analysis**		PRIORITY		STANDARD						Tape = T	Wipe = W	
Medical Device Analysis		RUSH		STANDARD						Drinking Water = DW		
Mold Analysis		RUSH		PRIORITY	STANDARD					Waste Water = WW		
										ASTM E1792 approved wipe media only		
Special Instructions: SC, stop positives, combine samples to make weight for TEM if needed												
Client Sample ID Number (Sample ID's must be unique)												
1		X								Sample Volume (L) / Area	Length (or Aliquots) x Width (or Area/Aliquot)	Sample Temperature (°C)
2		X										
3		X										
4		X										
5		X										
6		X										
7		X										
8		X										
9		X										
10		X										
11		X										
12		X										
13		X										

Eurofins Built Environment Testing East, LLC establishes a unique Lab Sample ID for each sample. By providing each unique Client Sample ID with the laboratory RES Job Number, Eurofins Built Environment Testing East, LLC will analyze incoming samples based on information received and will not be responsible for errors or omissions in calculations resulting from the inaccuracy of original data. By signing, client/company representative agrees that submission of the following samples for requested analysis as indicated on this Client of Custody shall constitute an analytical services agreement with payment terms of NET 30 days. Failure to comply with payment terms may result in a 1.5% monthly interest surcharge.

Relinquished By:	Date/Time: 06/10/2025 11:50:29	Sample Condition: Acceptable
Received By:	Date/Time: 06/10/2025 14:13:24	Carrier: Fed-Ex



Built Environment Testing

RES Job #: 664577

Submitted By: ECH Consultants

[illegible]

CHAIN OF CUSTODY

2151 Poona-1 Rd. Suite 100A For. U.S. 20106
Tel. 800-520-5140 Fax 010451 3442

GLY Lab Coat

664577

ECE Lab ID: RA-00

COMPANY INFORMATION		PROJECT INFORMATION	
ECEI CLIENT #:		Job Contact	
Company		Email To	
Address		Project Name	204 Mansboro Street
		Project ID#	Florence
Routing Email		PO #	
Tel		State of sample origin	

(U) [REDACTED]

IF TAT IS NOT MARKED STANDARD 3 DAY TAT APPLIES

[illegible]

Warning: A demand for instant fixes for the nation's economy by an unelected president

REMARKS SPECIAL INSTRUCTIONS

As a result, the model is able to capture the temporal dependencies between the input and output sequences.

25 Access Granted

Report Sources

Relinquished By	Date/Time	Received By	Date/Time
		IE	6/11/05 11:30

By submitting samples, you are agreeing to ECE's Terms and Conditions
Samples will be disposed of 30 days after analysis.

Page 64



COMPANY CONTACT INFORMATION			
Company	1010 Locust	Job Contact	Project
Project Name	104 Marlene Street		
Project ID #	Estimate	Te	Estimate

[illegible]

SCDES INSPECTOR LICENSE

**SCDES ISSUED**
Asbestos ID Card

Enga Hair



AIRSAMPLER	AS-00538	Expiration Date:
CONSULTBI	BI-01591	10/13/25
CONSULTPD	PD-00184	10/14/25
SUPERAHERA	SA-02878	03/04/26
		10/13/25